

PRECAUTION

Be careful not to grip the propeller shaft tube too tightly in the vise as this will cause deformation.

TROUBLESHOOTING

Problem	Possible cause	Remedy	Page
Noise	Sleeve yoke spline worn Center support bearing worn Spider bearing worn or stuck	Replace intermediate shaft Replace center support bearing Replace intermediate shaft or propeller shaft	PR-4 PR-4 PR-4
Vibration	Propeller and intermediate shafts runout Transmission extension housing rear bushing worn Sleeve yoke spline stuck	Replace shafts Replace bushing Replace intermediate shaft or propeller shaft	PR-4 PR-4